

# MONUMENT RECORD

Corner I.D. #

Q-45


Q-21

STATE OF INDIANA - COUNTY OF MONROE

Section Thirty-four, 34, Township 9 North, Range 1 East

Monument Description & Remarks: Stone found at the NE Corner of Section  
34. Corner witnessed in 1987.

Recovery Tie Drawing

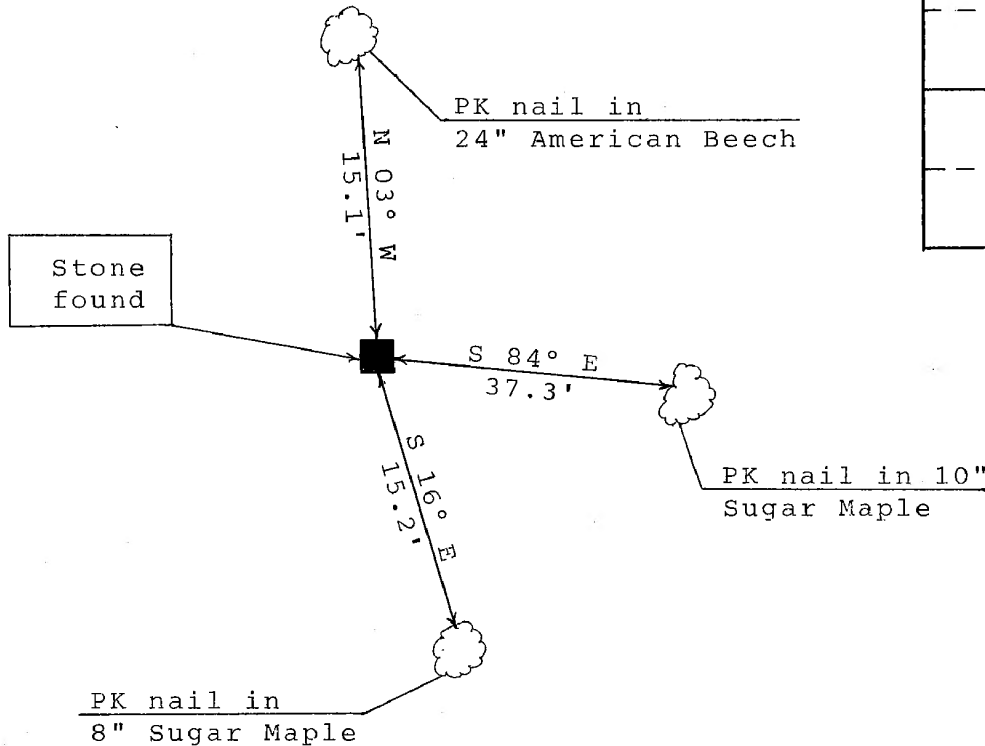

State of Indiana  
County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 18th day of October, 1993 A.D.

Space  
Reserved For  
Recording  
Officer

Indiana Registered Land Surveyor No. \_\_\_\_\_ or \_\_\_\_\_

Morgan-Monroe State Forest

United States Government Agency

Darrell Breedlove, Timber Specialist

Title

Field Book:

n/a

Page:

n/a

1c cont.) the fence intersection, itself, agrees closer to other evidence found. Vollmer and I measured south 1320 ft. along Brummett's Creek Rd. from a fence row at mid-section. A point, established at that distance, was bearing S89.6°E from the fence intersection, a bearing which is parallel to the south section line. The tree line of an old field corner, just across the section line in Sec.35 and near the NE corner, SE $\frac{1}{4}$ , SE $\frac{1}{4}$ , Sec.34, is bearing S89.6°E from the fence intersection at the center of SW $\frac{1}{4}$ , Sec.34. The NW corner of State Forest in SW $\frac{1}{4}$ , SE $\frac{1}{4}$ , Sec.34 (16 rods east of the  $\frac{1}{4}$ - $\frac{1}{4}$  corner) was established SE of U.S. Fee Taking Line marker no. 1693 and 174.7 ft. N62°E of marker no. 1695 (the latter is located on the lower slope terrace east of the old county road bridge across Brummett's Creek). This established corner contradicts the U.S. Army Corp. of Engineers plat, which suggests that marker no. 1693 is on the north line of SW $\frac{1}{4}$ , SE $\frac{1}{4}$ . However, other evidence shows that this marker is about 118 ft. north of the line. The corner is 84' N of 6" Sugar maple w/ metal S.F. sign.

d) NW corner, NE $\frac{1}{4}$ , SE $\frac{1}{4}$ , Sec.34

A fence intersection in an Am. Beech has a stack of three rocks 18 ft. east of it. Old plastic flagging surrounding the stack suggests that it marks the corner. The NE corner, SE $\frac{1}{4}$ , Sec.34 (see entry 1f of Sec.35 where it is also the SE corner, NW $\frac{1}{4}$ , Sec.35) is bearing S89.6°E from this stack of rocks. This bearing is parallel to the south section line. A survey by Graham in NE $\frac{1}{4}$ , NE $\frac{1}{4}$ , Sec.3, T8N, R1E was used to establish where the NE corner, NE $\frac{1}{4}$ , NE $\frac{1}{4}$ , Sec.3 should be located, and this corner is also the SW corner, SE $\frac{1}{4}$ , SE $\frac{1}{4}$ , Sec.34. The SW corner, SE $\frac{1}{4}$ , SE $\frac{1}{4}$ , Sec.34 (no marker found) is bearing S0.3°W from the stack of rocks. The west side of NE $\frac{1}{4}$ , SE $\frac{1}{4}$  was painted and posted using bearing S0.3°W from the stack of rocks. No marker was found at the SW corner, NE $\frac{1}{4}$ , SE $\frac{1}{4}$ , Sec.34. It was established by the intersection of two calculated bearings from other corners. The corner is 22 ft. east of an 8 in. Pignut hickory w/ a metal S.F. sign.

e) NE corner, Sec.34

This stone was witnessed(PK nails at base of trees) as follows:

|         | Az° | Species     | DBH (in.) | Distance (ft.) |
|---------|-----|-------------|-----------|----------------|
| S 16° E | 164 | Sugar Maple | 8         | 15.2           |
| N 03° W | 357 | Am. Beech   | 24        | 15.1           |
| S 84° E | 096 | Sugar Maple | 10        | 37.3           |

The SE corner, Sec.34 is bearing S0.1°E (1°W decl.) from this stone. This bearing was used to establish the NE corner, SE $\frac{1}{4}$ , Sec.34.

*Darrell Breedlove*

Darrell Breedlove  
Timber Specialist

2) On 1/12/88, I met with Slat and Lauri Klug to discuss the boundary I painted and posted on the west side of State Forest in SW $\frac{1}{4}$ , SE $\frac{1}{4}$ , Sec.34. After seeing the entire line, they seemed to accept its position.

Address: 1230 N. Brummett's Creek Rd.  
Bloomington

*Darrell Breedlove*

Darrell Breedlove  
Timber Specialist

*Reference  
Entry*

# MONUMENT RECORD

CORNER I.D.

Q-45

Q-21



STATE OF INDIANA - COUNTY OF MONROE

SECTION 26, TOWNSHIP 9 NORTH, RANGE 1 EAST

## MONUMENT DESCRIPTION & REMARKS

FOUND STONE AT THE SOUTHWEST CORNER OF SAID SECTION

### RECOVERY TIE DRAWING

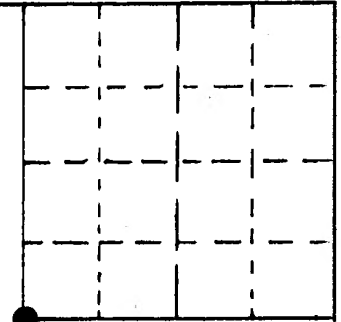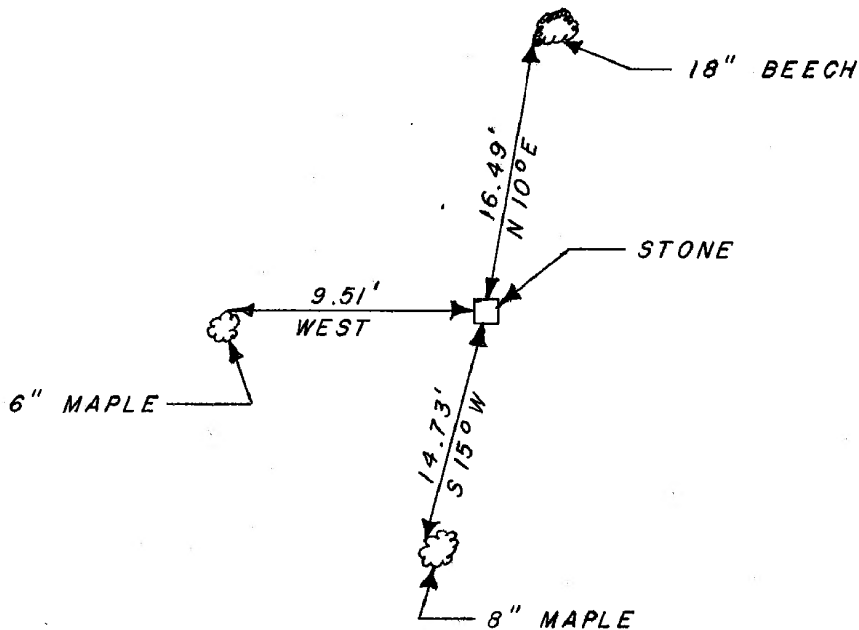

(•) AT CORNER



NOT TO SCALE

STATE OF INDIANA

COUNTY OF MONROE

I, EDMUND O. FARKAS HEREBY CERTIFY THAT THIS DOCUMENT WAS PREPARED UNDER MY DIRECTION IN ACCORDANCE WITH THE PROVISIONS OF SECTION 17-3-64-4 - 17-3-64-8 OF THE INDIANA CODE, BEING ACTS OF 1965, CHAPTER 319; AND THE ABOVE DATA IS GIVEN UNDER MY HAND AND SEAL THIS 17 TH. DAY OF AUGUST, 1983 A.D.

SPACE  
RESERVED  
FOR  
RECORDING  
OFFICER.

INDIANA REGISTERED LAND SURVEYOR NO. \_\_\_\_\_

OR \_\_\_\_\_

UNITED STATES GOVERNMENT AGENCY

TITLE

TOWNSHIP:  
BENTON SOUTH

CORNER I.D.

Q - 45